



Installation Instructions

CN1 Control Interface Breakout Boards

(Catalog Number: 2090-U3BB2-DM44, 2090-U3BB-DM12)

The CN1 Control Interface Breakout Boards provide discrete wire termination for signals on the CN1 Input/Output connector of the Ultra3000™ drives (2098-DSD-*xxx* or 2098-DSD-HV*xxx*) and Ultra3000 SERCOS drives (2098-DSD-*xxx*-SE or 2098-DSD-HV*xxx*-SE).

The 12-pin board (2090-U3BB-DM12) is intended for use with SERCOS drives, but may be used in non-SERCOS applications with minimal I/O requirements.

The user must supply an external 5.2 Vdc auxiliary power source if control power is to be retained when main power is removed from micro-sized drives (2098-DSD-005, -010, or -020).

Standard electrical tools (screwdriver, needlenose plier, wire cutter/stripper, etc.) are required to assemble the board.

Ultra3000 Pinouts and Corresponding Breakout Board Terminals

The following tables list the signals that are transferred from the CN1 connector of an Ultra3000 drive to a CN1 Breakout Board. Graphics show the important features on each breakout board.

Refer to the *Ultra3000 Digital Servo Drives Installation Manual* (2098-IN003*x*-EN-P) for additional information about these signals.


2090-U3BB2-DM44

This table lists signals that are transferred from the Ultra3000 CN1 connector using the 2090-U3BB2-DM44 board.

Terminal Marking	Signal	Connector-Pin
1	EPWR_5V	CN1-1
X- ¹	AUX_COM	CN1-2
X+ ¹	5V_AUX_PWR	CN1-3
4	AX+	CN1-4
5	AX-	CN1-5
6	BX+	CN1-6
7	BX-	CN1-7
8	IX+	CN1-8
9	IX-	CN1-9
16	AMOUT+	CN1-16
17	AMOUT-	CN1-17
18	BMOUT+	CN1-18
19	BMOUT-	CN1-19
20	IMOUT+	CN1-20
21	IMOUT-	CN1-21
22	ACOM	CN1-22
23	AOUT	CN1-23
24	ILIMIT	CN1-24
25	CMND+	CN1-25
26	CMND-	CN1-26

Terminal Marking	Signal	Connector-Pin
27	IOCOM	CN1-27 and CN1-28
29	IOPWR	CN1-29 and CN1-30
31	INPUT1	CN1-31
32	INPUT2	CN1-32
33	INPUT3	CN1-33
34	INPUT4	CN1-34
35	INPUT5	CN1-35
36	INPUT6	CN1-36
37	INPUT7	CN1-37
38	INPUT8	CN1-38
39	OUTPUT1	CN1-39
40	OUTPUT2	CN1-40
41	OUTPUT3	CN1-41
42	OUTPUT4	CN1-42
43	RELAY+	CN1-43
44	RELAY-	CN1-44
⏏	SHIELD	—
⏏	SHIELD	—

¹ 5V auxiliary power source is connected to the X+ (pos.) and X- (neg.) terminals. Do not ground the supply elsewhere in the system, as X-is connected to chassis ground of the drive.

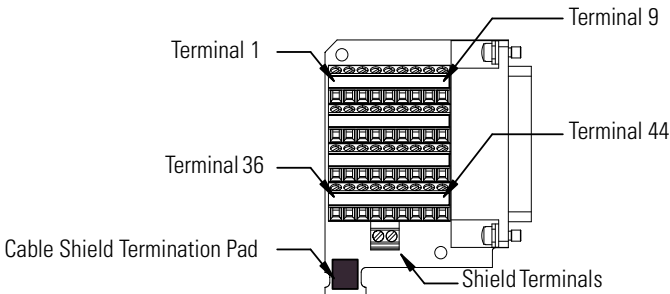


2090-U3BB-DM12

This table lists signals that are transferred from the Ultra3000 CN1 connector using the 2090-U3BB-DM12 board.

Signal by Interface Type		Connector- Pin
SERCOS	non-SERCOS	
AUXPWR ¹	AUXPWR ¹	CN1-3
AUXCOM ¹	AUXCOM ¹	CN1-2
ENABLE	INPUT1	CN1-31
HOME	INPUT2	CN1-32
REG1	INPUT3	CN1-33
REG2	INPUT4	CN1-34
OTRAV+	INPUT7	CN1-37
OTRAV-	INPUT8	CN1-38
I/OCOM	I/OCOM	CN1-27
BRAKE+	RELAY+	CN1-43
BRAKE-	RELAY-	CN1-44
SHIELD	SHIELD	—

¹ 5V auxiliary power source is connected to the AUXPWR (pos.) and AUXCOM (neg.) terminals.
Do not ground the supply elsewhere in the system; AUXCOM connects to chassis ground of the drive.

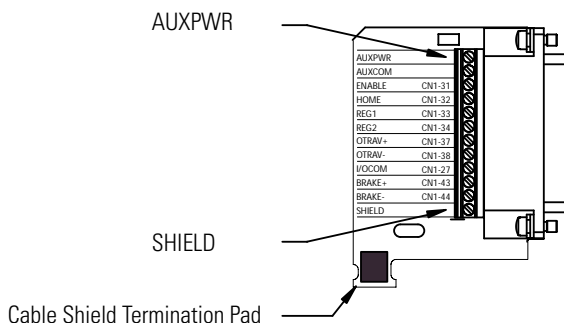


Installation

The CN1 Control Interface Breakout Board screw-clamp terminal block accommodates 0.14mm^2 to 1.5mm^2 (26 to 16 AWG) solid wire, or 0.14mm^2 to 1.00mm^2 (26 to 18 AWG) stranded wire. The circuit board provides shield termination and strain relief for the I/O cable.

I/O Cable Preparation

The figure below lists the suggested trim lengths [mm (in.)] for the feedback cable jacket and signal wires.

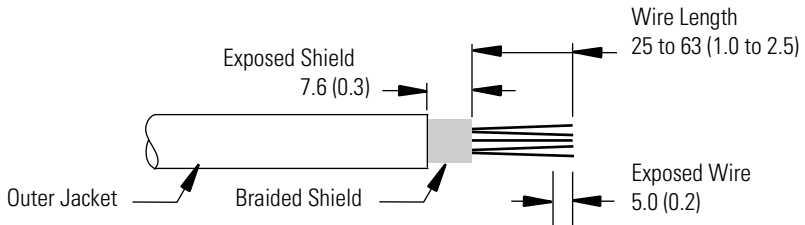

Breakout Board Assembly and Installation


This section details how to affix the I/O cable to the breakout board circuit card for proper cable termination, and how to connect the assembly to the CN1 connector on the drive.

TIP




Wiring can be performed after the break-out board is attached to the drive. However, working on a horizontal surface speeds assembly.

1. Position the exposed cable shield on the circuit board's metal termination strip, and fasten the cable shield to the circuit board assembly with the supplied cable tie as shown below. Use a minimum tension of 80 N (18 lbs) to ensure that the cable is secure, and the shield makes a good electrical connection to the circuit board.

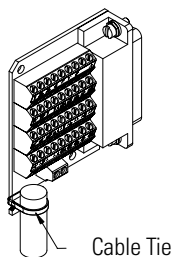


2090-U3BB2-DM44 shown

2. Insert the individual signal wires into the appropriate terminals on either circuit board, and tighten each terminal to 0.25 N-m (2.2 lb-in.). Gently pull on each wire to ensure fastness. Reinsert any loose wires.
3. Plug either breakout board assembly into the CN1 connector of the drive, and tighten the two jack screws to 0.40 N-m (3.5 lb-in.).

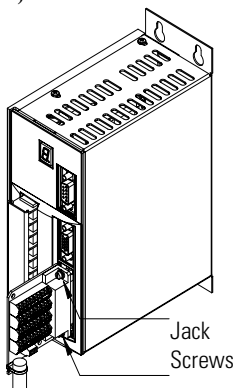


Dimensions

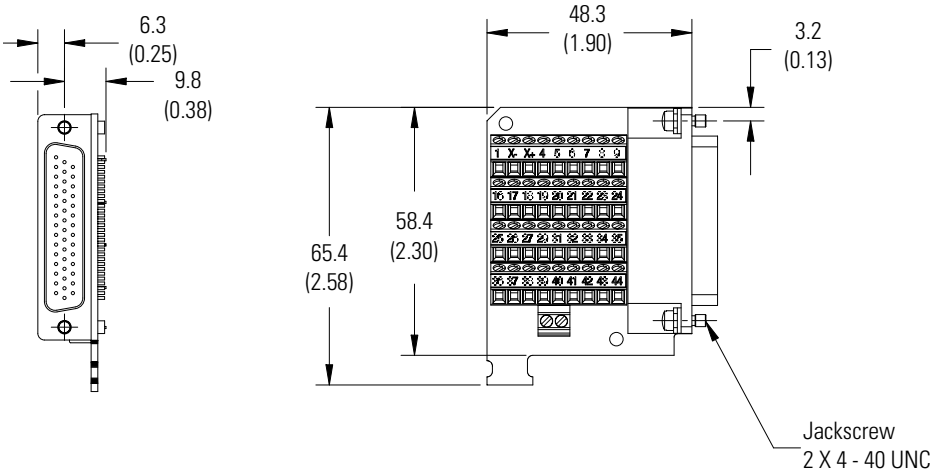

2090-U3BB2-DM44 shown

Dimensions are in millimeters (inches)



Specifications

Specification		Description
Cable Diameter		12.7 mm (0.50 in.) maximum
Wire Diameter	Solid	0.14mm ² to 1.5mm ² (26 to 16 AWG)
	Stranded	0.14mm ² to 1.00mm ² (26 to 18 AWG)
Operating Temperature		0° to 55° C (32° to 131° F)
Weight	2090-U3BB2-DM44	36g (0.08 lbs)
	2090-U3BB-DM12	50g (0.11 lbs)

Related Documentation

The following documents contain additional information concerning related Allen-Bradley products. To obtain a copy, contact your local Rockwell Automation office or distributor, or access on-line at: www.theautomationbookstore.com or www.ab.com/manuals/gmc.

For information about:	Read this document:	Publication Number
Other Ultra Family Breakout Boards	<i>CN2 Control Interface Breakout Board</i>	2090-IN006x-EN-P
	<i>CN1 Control Interface Breakout Boards with Integral 24V-to-5V Auxiliary Power Converter</i>	2090-IN008x-EN-P
Connecting to an Ultra3000 drive	<i>Ultra3000 Digital Servo Drives Installation Manual</i>	2098-IN003x-EN-P
Commissioning and troubleshooting an Ultra3000 drive	<i>Ultra3000 Digital Servo Drives Integration Manual</i>	2098-IN005x-EN-P
A glossary of industrial automation terms and abbreviations	<i>Allen-Bradley Industrial Automation Glossary</i>	AG-7.1
How to minimize and control system-level noise	<i>System Design for Control of Electrical Noise</i>	GMC-RM001x-EN-P
An overview of Allen-Bradley motion controls and systems.	<i>Motion Control Selection Guide</i>	GMC-SG001x-EN-P

For more information refer to our web site: www.ab.com/motion
For Allen-Bradley Technical Support information refer to: www.ab.com/support or Tel: (1) 440.646.5800

Allen-Bradley is a registered trademark of Rockwell Automation, Inc.
Ultra3000 is a trademark of Rockwell Automation, Inc.
SERCOS Interface is a trademark of the Interests Group SERCOS interface e.V. (IGS).

www.rockwellautomation.com

Corporate Headquarters

Rockwell Automation, 777 East Wisconsin Avenue, Suite 1400, Milwaukee, WI, 53202-5302 USA, Tel: (1) 414.212.5200, Fax: (1) 414.212.5201

Headquarters for Allen-Bradley Products, Rockwell Software Products and Global Manufacturing Solutions

Americas: Rockwell Automation, 1201 South Second Street, Milwaukee, WI 53204-2496 USA, Tel: (1) 414.382.2000, Fax: (1) 414.382.4444
Europe/Middle East/Africa: Rockwell Automation SA/NV, Vorstlaan/Boulevard du Souverain 36, 1170 Brussels, Belgium, Tel: (32) 2 663 0600, Fax: (32) 2 663 0640
Asia Pacific: Rockwell Automation, 27/F Citicorp Centre, 18 Whitfield Road, Causeway Bay, Hong Kong, Tel: (852) 2887 4788, Fax: (852) 2508 1846

Headquarters for Dodge and Reliance Electric Products

Americas: Rockwell Automation, 6040 Ponders Court, Greenville, SC 29615-4617 USA, Tel: (1) 864.297.4800, Fax: (1) 864.281.2433
Europe/Middle East/Africa: Rockwell Automation, Brühlstraße 22, D-74834 Elztal-Dallau, Germany, Tel: (49) 6261 9410, Fax: (49) 6261 17741
Asia Pacific: Rockwell Automation, 55 Newton Road, #11-01/02 Revenue House, Singapore 307987, Tel: (65) 6356-9077, Fax: (65) 6356-9011